


FACILITY	DATE
Sample Location	16/02/2004

Location: Living Room- Below Windows


## INFRARED IMAGES

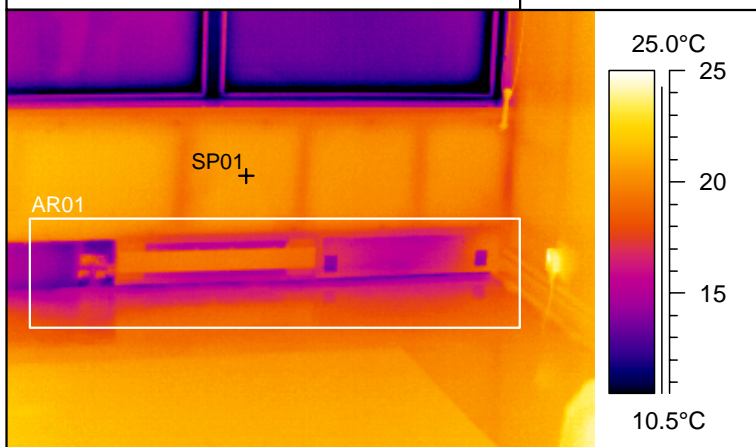

Condition:

No Pressure

IR information	Value
Date of creation	16/02/2004
Time of creation	7:25:30 PM
Object parameter	Value
Ambient temperature	21.0°C
Label	Value
SP01	20.6°C
AR01 : min	12.0°C

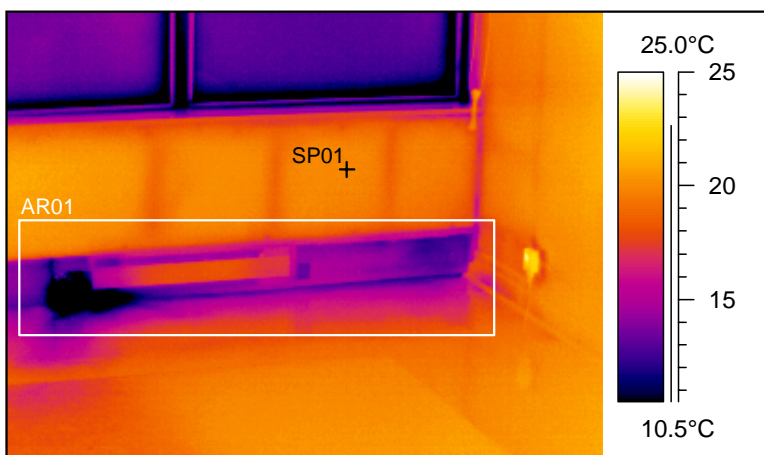

Condition:

Negative Pressure

IR information	Value
Date of creation	16/02/2004
Time of creation	7:40:24 PM
Object parameter	Value
Ambient temperature	21.0°C
Label	Value
SP01	19.8°C
AR01 : min	0.3°C

## Photo



Notes:

Concentrated cold areas at the holes in the block wall and at the south demising wall (right side) indicate air leakage.