


FACILITY	DATE
Sample House: Exterior	Jan. 18/05

Location: North Turret Windows

INFRARED IMAGE

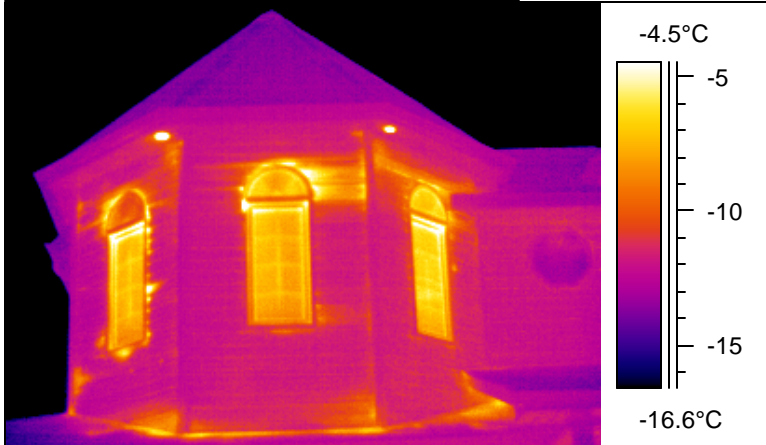

PHOTO



IR information	Value
Date of creation	18/01/2005
Time of creation	7:57:28 PM
Object parameter	Value
Ambient temperature	-10.0°C

INFORMATION:

Infrared image of the exterior view of the north turret windows.
 Heat loss noted around all shown windows and along the bottom of the turret.
 (at red arrows in the photo)

Suspect: poor window installations. Missing or reduced insulation at location. Air leakage at location.
 Inspect further to verify cause.